

KILEWS® AUTOMATIC INDUSTRIAL CORDLESS
BRUSHLESS LOW TORQUE BATTERY SCREWDRIVERS SERIES
SKC-PTA-BS Series



External Dimension

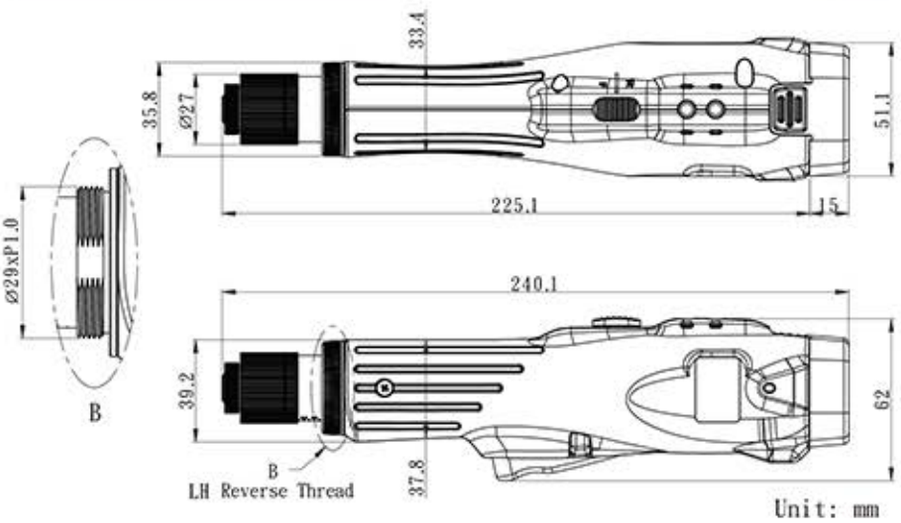


Torque Range Reference Chart

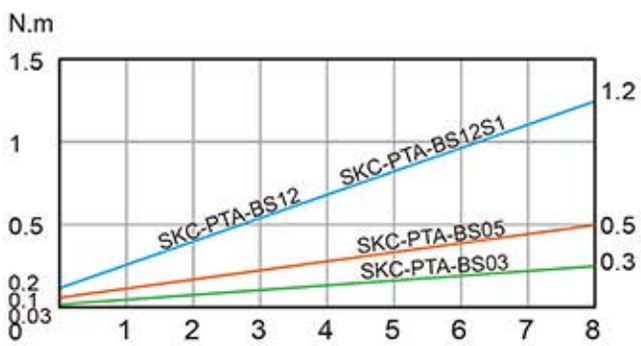

Specifications

Model		SKC-PTA-BS03	SKC-PTA-BS05	SKC-PTA-BS12	SKC-PTA-BS12S1
Input Voltage		7.2V			
Torque (N.m)	Hard Joint	0.03~0.3	0.1~0.5	0.2~1.2	0.2~1.2
	Soft Joint	0.03~0.24	0.1~0.4	0.2~0.96	0.2~0.96
Repeatable Torque Accuracy		±3%			
Torque Adjustment		External Stepless			
Free Speed (r.p.m) ±10%	HI	350	1000	1000	500
	LO	200	700	700	350
Weight (kg)		0.53 (Without Battery)			
Size (mm)		225X62 (LXH Without Battery)			
Applicable Battery		SKC-LB0730S			
Applicable Charge Station		SKC-P25W			
Applicable Torque Meter		KTM-15			
Applicable Bit Type		B 9.5			



K202605